

FPCR | environment
& design



ARBORICULTURAL ASSESSMENT

Client

Bloor Homes

Project

Toton West

Date

April 2025

CONTENTS

1.0	INTRODUCTION	1
2.0	PLANNING POLICY	2
3.0	SURVEY METHODOLOGY	3
4.0	RESULTS	7
5.0	ARBORICULTURAL IMPACT ASSESSMENT	10
6.0	NEW TREE AND HEDGEROW PLANTING	12
7.0	TREE PROTECTION MEASURES	14
8.0	TREE MANAGEMENT	16

TABLES

Table 1: Summary of Trees by Retention Category

Table 2: Summary of Impact on Tree Stock

FIGURES

Figure 1: The chart of girth in relation to age and development classification of trees

PLANS

Tree Survey Plan (10889-T-01)

Tree Retention Plan (10889-T-02-03)

APPENDICES

Appendix A: Tree Schedule

Appendix B: Protective Fencing Specifications

Rev	Issue Status	Prepared/Date	Approved/Date
-	Final	TEP / 25/02/25	AW /26/02/25
A	Final	TEP / 09/04/25	AW / 09/04/25
B	Final	TEP / 24/04/25	AW / 24/04/25

1.0 INTRODUCTION

- 1.1 This report has been prepared by FPCR Environment and Design Limited on behalf of Bloor Homes to present the findings of an Arboricultural Assessment and survey of trees located at Toton West (hereafter referred to as the site), OS Grid Ref SK 491 355.

Site Description

- 1.2 The site was located to the west of Nottingham, to the north of the large village of Toton which is found within the borough of Broxtowe. Tree cover was for the most part confined to the boundaries of the field parcels that made up the assessment area. The majority of these trees were native in origin and had naturally colonised. To the north of the site was the A52 Brian Clough Way and abutting the southern boundary was the residential edge of Toton. To the west of the site was Toton railway sidings.

Scope of Assessment

- 1.3 A tree survey and assessment of existing trees was carried out by FPCR Environment and Design on Tuesday 20th August 2024 in accordance with guidance contained within British Standard 5837:2012 'Trees in Relation to Design, Demolition and Construction - Recommendations' (hereafter referred to as BS5837).
- 1.4 This report has been produced to accompany an outline planning application for a residential development of up to 420 homes and associated open space and infrastructure.
- 1.5 The purpose of this report is therefore to firstly, present the results of this assessment of the existing trees' arboricultural value, based on their current condition and quality and to secondly, provide an assessment of impact arising from the proposed development of the site.

2.0 PLANNING POLICY

National Planning Policy Framework December 2024

- 2.1 National Planning Policy is defined by the National Planning Policy Framework (NPPF). This sets out the Government's most current and up to date planning policies for England and how these should be applied. The current NPPF is dated December 2024.
- 2.2 Paragraphs 10 and 11 of the NPPF state that there is a presumption in favour of sustainable development and states that for decision making, the LPA should be 'c) approving development proposals that accord with an up-to-date development plan without delay'.
- 2.3 In relation to arboriculture, the NPPF states that:
- 136 *'Trees make an important contribution to the character and quality of urban environments, and can also help mitigate and adapt to climate change. Planning policies and decisions should ensure that new streets are tree-lined (footnote 52), that opportunities are taken to incorporate trees elsewhere in developments (such as parks and community orchards), that appropriate measures are in place to secure the long-term maintenance of newly-planted trees, and that existing trees are retained wherever possible. Applicants and local planning authorities should work with highways officers and tree officers to ensure that the right trees are planted in the right places, and solutions are found that are compatible with highways standards and the needs of different users'. (footnote 52: unless, in specific cases, there are clear, justifiable and compelling reasons why this would be inappropriate)*
 - 193 (c) *'development resulting in the loss or deterioration of irreplaceable habitats (such as ancient woodland and ancient or veteran trees) should be refused, unless there are wholly exceptional reasons (footnote 70) and a suitable compensation strategy exists'.*
 - and provides specific guidance that:
 - 193 (d) *'development whose primary objective is to conserve or enhance biodiversity should be supported; while opportunities to improve biodiversity in and around developments should be integrated as part of their design, especially where this can secure measurable net gains for biodiversity or enhance public access to nature where this is appropriate'.*
- 2.4 With reference to paragraph 193 (c), examples of what is deemed to be 'wholly exceptional' are included within Footnote 70 and provides the examples of 'infrastructure projects (including nationally significant infrastructure projects, orders under the Transport and Works Act and hybrid bills), where the public benefit would clearly outweigh the loss or deterioration of habitat'.

3.0 SURVEY METHODOLOGY

- 3.1 The survey of trees has been carried out in accordance with the criteria set out in Chapter 4 of BS5837. The survey has been undertaken by a suitably qualified and experienced arboriculturist and has recorded information relating to all those trees within the site and those adjacent to the site which may be of influence to any proposals. Trees were assessed for their arboricultural quality and benefits within the context of the proposed development in a transparent, understandable, and systematic way.
- 3.2 Trees have been assessed as groups, hedgerows or woodland where it has been determined appropriate.
- The term group has been applied where trees form cohesive arboricultural features either aerodynamically, visually or culturally including biodiversity or habitat potential for example parkland or wood pasture.
 - For the purposes of this assessment, a hedgerow is described as any boundary line of trees or shrubs less than 5m wide at the base and are managed under a regular pruning regime.
 - For the purposes of this assessment woodland is described as a habitat where 'trees are the dominant plant form. The individual tree canopies generally overlap and interlink, often forming a more or less continuous canopy'¹. Woodlands however, are not just formed of trees and generally include a great variety of other plants. These will include 'mosses, ferns and lichens, as well as small flowering herbs, grasses and shrubs'².
- 3.3 An assessment of individual trees within groups, hedgerows and woodland has been made where a clear need to differentiate between them, for example, to highlight significant variation between attributes including physiological or structural condition or where a potential conflict may arise.

BS5837 Categories

- 3.4 Trees, groups, hedgerows, and woodland have been divided into one of four categories based on Table 1 of BS5837, 'Cascade chart for tree quality assessment'. For a tree to qualify under any given category it should fall within the scope of that category's definition (see below).
- 3.5 Category U trees are those which would be lost in the short term for reasons connected with their physiology or structural condition. They are, for this reason not considered in the planning process on arboricultural grounds.
- 3.6 Categories A, B and C are applied to trees that should be of material consideration in the development process. Each category also having one of three further sub-categories (i, ii, iii) which are intended to reflect arboricultural, landscape and cultural or conservation values accordingly.

¹ Ancient woodland, ancient trees and veteran trees: advice for making planning decisions - GOV.UK (www.gov.uk)

² http://www.countrysideinfo.co.uk/woodland_manage/whatis.htm

- 3.7 Category (U) – (Red): Trees which are unsuitable for retention and are in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years. Trees within this category are:
- Trees that have a serious irremediable structural defect such that their early loss is expected due to collapse and includes trees that will become unviable after removal of other category U trees.
 - Trees that are dead or are showing signs of significant, immediate or irreversible overall decline.
 - Trees that are infected with pathogens of significance to the health and/ or safety of other nearby trees or are very low quality trees suppressing adjacent trees of better quality.
 - Certain category U trees can have existing or potential conservation value which may make it desirable to preserve.
- 3.8 Category (A) – (Green): Trees that are considered for retention and are of high quality with an estimated remaining life expectancy of at least 40 years with potential to make a lasting contribution. Such trees may comprise:
- Subcategory (i) trees that are particularly good examples of their species, especially if rare or unusual, or are essential components of groups such as formal or semi-formal arboricultural features for example the dominant and/or principal trees within an avenue.
 - Subcategory (ii) trees, groups or woodlands of particular visual importance as arboricultural and / or landscape features.
 - Subcategory (iii) trees, groups or woodlands of significant conservation, historical, commemorative or other value for example veteran or wood pasture.
- 3.9 Category (B) – (Blue): Trees that are considered for retention and are of moderate quality with an estimated remaining life expectancy of at least 20 years with potential to make a significant contribution. Such trees may comprise:
- Subcategory (i) trees that might be included in category A but are downgraded because of impaired condition for example the presence of significant though remediable defects, including unsympathetic past management and storm damage.
 - Subcategory (ii) trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals or trees occurring as collectives but situated so as to make little visual contribution to the wider locality.
 - Subcategory (iii) trees with material conservation or other cultural value.
- 3.10 Category (C) – (Grey): Trees that are considered for retention and are of low quality with an estimated remaining life expectancy of at least 10 years or young trees with a stem diameter below 150mm. Such trees may comprise:
- Subcategory (i) unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories.

- Subcategory (ii) trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value or trees offering low or only temporary / transient screening benefits.
- Subcategory (iii) trees with no material conservation or other cultural value.

Ancient and Veteran Trees

- 3.11 Various published methodologies are currently available for the identification of Ancient and Veteran trees which, due to the complexity and subjectivity of the process of defining and assessing these trees, often have conflicting definitions.
- 3.12 This assessment and the criterion for defining a veteran tree is based upon the definition within BS:5837.
- 3.13 "Tree that, by recognized criteria, shows features of biological, cultural or aesthetic value that are characteristic of, but not exclusive to, individuals surviving beyond the typical age range for the species concerned".
- 3.14 NOTE These characteristics might typically include a large girth, signs of crown retrenchment and hollowing of the stem
- 3.15 Stem girth is the most reliable guide when determining the age of trees and in normal growing conditions, ancient and veteran trees are those which have a large girth by comparison with other trees of the same species. To inform the assessment of chronological age reference has been made to the chart provided within Lonsdale (2013) (shown below in Figure 1).
- 3.16 BS:5837 does not provide a definition for ancient trees and therefore the assessment and the criterion being used for identifying ancient tree is based upon government guidance on, Ancient woodland, ancient trees and veteran trees: advice for making planning decisions³ which states.
- "All ancient trees are veteran trees, but not all veteran trees are ancient. The age at which a tree becomes ancient, or veteran will vary by species because each species ages at a different rate."*

³ Ancient woodland, ancient trees and veteran trees: advice for making planning decisions - GOV.UK (www.gov.uk)

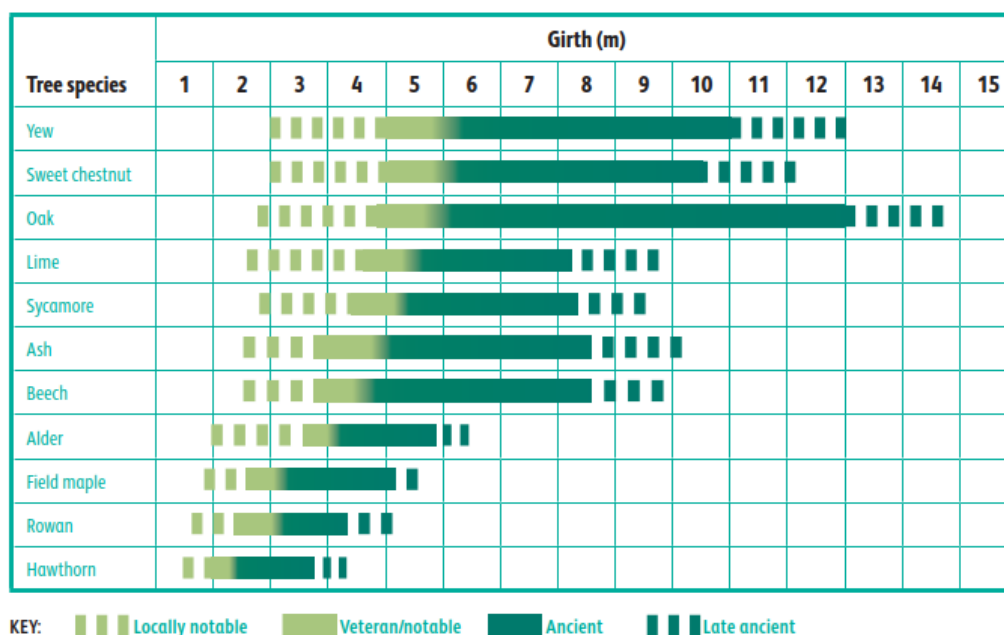


Figure 1: The chart of girth in relation to age and development classification of trees, as shown in Lonsdale (2013)⁴.

- 3.17 Ancient and veteran trees are also material considerations within the planning process and their importance is specifically recognised within the National Planning Policy Framework (NPPF) 2024, which includes its own definition of ancient and veteran trees:
- 3.18 'A tree which, because of its age, size, and condition, is of exceptional biodiversity, cultural or heritage value. All ancient trees are veteran trees. Not all veteran trees are old enough to be ancient but are old relative to other trees of the same species. Very few trees of any species reach the ancient life-stage.'⁵

Considerations and Limitations of the Tree Survey

- 3.19 The survey was completed from ground level only and from within the boundary of the site. Aerial tree inspections or an assessment of the internal condition of the stem/s or branches were not undertaken at this stage as this level of survey is beyond the scope of the initial assessment.
- 3.20 The statements made in this report regarding the assessed applies to the date of survey and cannot be assumed to remain unchanged. It will be necessary to review all comments and observations made within this report, in accordance with sound arboricultural practice, within two years of the date of survey (unless explicitly stated elsewhere within this report). Further review may also be necessary where site conditions change or works to trees are carried out which have not been specified in detail within this report.

⁴ Lonsdale, D. (Ed.). 2013). Ancient and other veteran trees: further guidance on management. London: The Tree Council.
⁵ Ancient woodland, ancient trees and veteran trees: advice for making planning decisions - GOV.UK (www.gov.uk)

- 3.21 Hedgerows are identified as a Habitat of Principal Importance (HPI) as listed within Section 41 of the Natural Environment and Rural Communities (NERC) Act 2006. The tree survey conducted, in accordance with BS5837, does not assess hedgerows against the Hedgerow Regulations 1997 or specifically from an ecological perspective, and is outside the scope of this assessment.
- 3.22 It may be necessary during detailed design to undertake further assessment and accurate positioning of woody species within tree groups and hedgerows to assist structural calculations for foundation design of structures in accordance with NHBC Chapter 4.2 Building near Trees.

4.0 RESULTS

- 4.1 A total of one individual tree, eighteen groups of trees and six hedgerows were surveyed as part of the Arboricultural Assessment. Trees were surveyed as individual trees and groups of trees where examples are clearly present as per the description. Refer to the Tree Survey Plan and Appendix A – Tree Schedule for full details of the trees included in this assessment. The table below summarises the trees assessed.
- 4.2 Appendix A presents details of all individual trees, groups and hedgerows recorded during the assessment including heights, diameters at 1.5m from ground level, crown spread (given as a radial measurement from the stem), age class, comments as to the overall condition at the time of inspection, BS5837 category of quality and suitability for retention and the root protection area (RPA), calculated in accordance with Annex C, D and Section 4.6 of BS5837:2012.
- 4.3 General observations particularly of structural and physiological condition for example the presence of any decay and physical defect and preliminary management recommendations have also been recorded where appropriate.
- 4.4 The individual positions of trees, groups, hedgerows and woodlands have been shown on the Tree Survey Plan. The positions of trees are based on a topographical / land survey, as far as possible, supplied by the client. Where topographical information has not identified the position of trees these have been plotted using a global positioning system and aerial photography to provide approximate locations. The crown spread, root protection area and shade pattern (where appropriate) are also indicated on this plan.

Results Summary

- 4.5 Table 1 below summarises the trees assessed and several of the trees have been discussed in more detail following the table, owing to their physical condition or arboricultural significance.

Table 1: Summary of Trees by Retention Category

	Individual Trees	Total	Groups of Trees	Total
Category U - Unsuitable		0		0
Category A (High Quality / Value)		0		0
Category B (Moderate Quality / Value)		0	G4, G5, G7, G8, G9, G11, G12, G17	8
Category C (Low Quality / Value)	T1	1	G1, G2, G3, G6, G10, G13, G14, G15, G16, G18, H1, H2, H3, H4, H5, H6	16

Category B Specimens

- 4.6 A total of eight groups of trees were recorded as being moderate in quality and retention category B. These specimens were evenly distributed across the site and ranged from semi mature to mature in proportions. Collectively these trees provided key landscape features and contained only minor defects such as branch stubs, pruning wounds and established ivy growth. Due to the close proximity to each other, the majority of these trees have formed conjoining crowns which would limit the possibility of removing some specimens without impact upon others.
- 4.7 The common features observed throughout the tree stock comprised of features associated with continuous growth such as basal suckers and epicormic growth within crowns. Features resulting from natural abscission of material creating branch stubs, broken branches, branch socket cavities and bark wounds. Dead branches were also regularly observed in various proportions.

Category C Specimens

Individual Trees

- 4.8 Trees of low quality comprised of one individual specimen which was mature ash. It housed typical features and was of fair overall condition.

Groups of Trees

- 4.9 Ten groups of trees were recorded. These were either outgrown boundary trees or unmanaged garden trees. Due to either the lack of management or low collective landscape value, this tree cover was regarded as retention category C.

Hedgerows

- 4.10 Due to an active regime of boundary tree management, six hedgerows were recorded across the site. The majority of these hedgerows were maintained by annual cutting which had created dense, clipped and consolidated structures. The hedgerows were all in fair physical condition generally, albeit housing some typical minor broken branches, branch stubs and crossing and / or rubbing branches. Gaps could be identified where hedgerow stock had either failed or had become overwhelmed by undergrowth such as bramble.

Ancient and Veteran Trees

- 4.11 None of the assessed trees were considered as ancient or veteran trees in accordance with our veteran survey methodology.

Statutory Considerations

- 4.12 Local authorities have a Duty under the Town and Country Planning Act to create Tree Preservation Orders (TPO) to protect and preserve specific trees and woodlands that bring significant amenity benefit to a particular site or location.
- 4.13 Under a TPO it is a criminal offence to cut down, top, lop, uproot or wilfully destroy a tree protected by that Order, or to cause or permit such actions, if carried out without the prior written consent of the acting LPA.
- 4.14 The presence of any Tree Preservation Orders or Conservation Area designations that may affect the site has yet to be confirmed by Broxtowe Borough Council. Before any tree works are undertaken confirmation of the presence of the statutory constraints should be sought from the Local Planning Authority.
- 4.15 Information provided on Tree Preservation Orders and Conservation Areas is accurate to the date of this assessment and cannot be assumed to remain unchanged. The last check was carried out on the Wednesday 9th April 2025.

5.0 ARBORICULTURAL IMPACT ASSESSMENT

- 5.1 The following paragraphs present a summary of the tree survey and discussion of particular trees and groups recorded in the context of any proposed development in the form of an Arboricultural Impact Assessment in accordance with section 5.4 of BS5837. Any final tree retentions will need to be reconciled with the advice contained within this report.
- 5.2 The AIA has been based upon the Illustrative Master Plan and seeks to outline the relationship between the proposals and the existing trees and hedgerows. The drawing shows the proposals for residential dwellings and associated infrastructure.
- 5.3 An overlay of the layout has been incorporated in the Tree Retention Plan to assist in identifying the relationship and any potential conflicts between the proposals and the existing trees and hedgerows. The plan also identifies which trees would be required to be removed or retained as part of the proposed development.
- 5.4 A Detailed Access Arrangement Plan (10889-T-03) has also been provided to demonstrate the location of the primary access position in relation to the surrounding tree cover allowing the identification of any potential conflicts through implementation of the site access.
- 5.5 Table 3 below summarises the impact on tree stock and these impacts have been discussed in more detail following the table.

Table 3: Summary of Impact on Tree Stock

	Trees to be Retained	Total	Trees to be Removed in full or part	Total
Category U - Unsuitable		0		0
Category A (High Quality / Value)		0		0
Category B (Moderate Quality / Value)	G4, G5, G7, G8, G11, G12, G17	7	G9(part)	1
Category C (Low Quality / Value)	T1, G1, G2, G3, G6, G18, H1, H3, H4, H5, H6	11	G10, G13, G14, G15(part), G16(part), H2(part)	6

- 5.6 Construction of the Stapleford Lane access road junction necessitates the removal of specific trees to achieve required junction and its associated visibility splays. This includes four trees from group G9, and the complete removal of groups G10 and G14. The access road's alignment significantly impacts the root protection areas of these trees, rendering their retention unsustainable. The part removal of G9 for access was shown in the outline application (12/00585/OUT).
- 5.7 Development of the proposed dwellings and internal road network will result in the removal of entire tree group G13, and sections of groups G15 and G16. Additionally, a break in hedgerow H2 is required to establish a pedestrian connection to the off-site path.

Discussion

- 5.8 In conclusion for arboriculture, the proposals are considered to meet the aims and objectives national policy through careful consideration of the design and retention of a high proportion of the existing tree cover. The retention of, coupled with targeted future management and enhancement of the existing and future tree cover will meet many of the individual aspirations set out in the policy.
- 5.9 In a subsequent Reserved Matters application, the final layout of the scheme should be informed by this assessment. The routing of below ground services should also consider retained trees and should not encroach within the Root Protection Areas of retained trees, as recommended by the guidance given in section 7.7 of BS5837.

6.0 NEW TREE AND HEDGEROW PLANTING

- 6.1 The success of any landscaping scheme relies on an adequate provision of a high-quality rooting environment within which trees can thrive and reach their full potential. Planting trees with due care and consideration can, in the long term, provide a greater return on a schemes green investment and ensure trees remain healthy and grow to mature proportions.
- 6.2 Wherever possible, following discussions with the developer and utility companies, common service trenches should be specified to minimise land take associated with underground service provision and facilitation access for future maintenance.
- 6.3 Tree planting should be avoided where they may obstruct overhead power lines or cables. Any underground apparatus should be ducted or otherwise protected at the time of construction to enable trees to be planted without resulting in future conflicts.
- 6.4 As part of the subsequent reserved matters application, should the application be approved, an adequate quantity of structured tree planting should be provided to mitigate for any tree removal necessary to implement the development. The purpose and function of this new tree planting should be understood from the start of any design stages so that key objectives from a landscape perspective can also be achieved.
- 6.5 The landscaping scheme should consider the use of both native tree species (for their low maintenance requirements and nature conservation value) and ornamental species (for their contribution to urban design and amenity value). Species choices should be selected on the basis of their suitability for the final site use. Furthermore, during the design process consultation should be made with the Local Planning Authority to obtain information on their tree strategy and incorporate the planting proposals with any local policies and initiatives and/or Biodiversity Action Plans (BAP).
- 6.6 When deciding upon suitable tree species, careful consideration would need to be given to the following: ultimate height and canopy spread, form, habit, density of crown, potential shading effect, colour, water demand, soil type and maintenance requirements in relation to both the built form of the new development and existing properties.
- 6.7 Through careful species selection, the landscape scheme shall reduce the risk of trees being removed in the future on the grounds of nuisance. Nuisance can be perceived in a number of ways and vary from person to person however most commonly, within the context of trees, low overhanging branches, excessive shading, seasonal leaf fall and the misinformed perception that trees close to buildings cause damage.
- 6.8 Hedgerows are identified as a Habitat of Principal Importance (HPI) as listed within Section 41 of the Natural Environment and Rural Communities (NERC) Act 2006. Consequently, it is important that the proposed scheme delivers a net gain in terms of linear hedgerows through new planting to compensate for any losses. Species should be native, and characteristic of the locality.

Rooting Environment and Soil Volumes

- 6.9 The success of any landscaping scheme relies on an adequate provision of a high-quality rooting environment within which trees can thrive and reach their full potential. Planting trees with due care and consideration can, in the long term, provide a greater return on a schemes green investment and ensure trees remain healthy and grow to mature proportions. Healthy mature trees integrate well into the built environment; increase the maturity of the landscape; help provide a natural green and leafy urban environment in which people would want to reside whilst also benefiting local wildlife.
- 6.10 The planting of trees within confined urban environments should consider the use of appropriately designed planting pits specifically engineered to promote tree health and longevity. Crucially the aim will be to provide an adequate volume of quality soil for roots to suitably develop by calculating the amount of available soil volumes needed and selecting species whose mature size is compatible with the site. This is an integral component of the planning stage (Lindsey & Bassuk, 1991).

General Planting Recommendations

- 6.11 Wherever possible, following discussions with the developer and utility companies, common service trenches should be specified to minimise land take associated with underground service provision and facilitation access for future maintenance.
- 6.12 Tree planting should be avoided where they may obstruct overhead power lines or cables. Any underground apparatus should be ducted or otherwise protected at the time of construction to enable trees to be planted without resulting in future conflicts.

7.0 TREE PROTECTION MEASURES

- 7.1 Retained trees should be adequately protected during works through the erection of the requisite tree protection measures. These protection measures should be detailed as part of a site-specific Arboricultural Method Statement, which could be imposed as a condition of planning approval.
- 7.2 Measures to protect trees should follow the guidance in BS5837 and be applied where necessary for the purpose of protecting trees within the site whilst allowing sufficient access for the implementation of the proposed layout. These have been broadly summarised below.

General Information and Recommendations

- 7.3 All trees retained on site should be protected by suitable barriers or ground protection measures around the calculated RPA, crown spread of the tree or other defined constraints of this assessment as detailed by section 6 and 7 of BS5837.
- 7.4 Barriers should be erected prior to commencement of any construction work and once installed, the area protected by fencing or other barriers will be regarded as a construction exclusion zone.
- 7.5 Any trees that are not to be retained as part of the proposals should be felled prior to the erection of protective barriers. Particular attention needs to be given by site contractors to minimise damage or disturbance to retained specimens.
- 7.6 Construction access may take place within the root protection area if suitable ground protection measures are in place. This may comprise single scaffold boards over a compressible layer laid onto a geo-textile membrane for pedestrian movements. Vehicular movements over the root protection area will require the calculation of expected loading and the use of proprietary protection systems.

Tree Protection Barriers

- 7.7 Tree protection fencing should be fit for the purpose of excluding any type of construction activity and suitable for the degree and proximity of works to retained trees. Barriers must be maintained to ensure that they remain rigid and complete for the duration of construction activities on site.
- 7.8 In most situations, fencing should comprise typical construction fencing panels attached to scaffold poles driven vertically into the ground, as illustrated in Appendix B.
- 7.9 Where site circumstances and the risk to retained trees do not necessitate the default level of protection an alternative will be specified appropriate to the level / nature of anticipated construction activity.

Protection outside the exclusion zone

- 7.10 Once the areas around trees have been protected by the barriers, any works on the remaining site area may be commenced providing activities do not impinge on protected areas.

- 7.11 All weather notices should be attached to the protective fencing to indicate that construction activities are not permitted within the fenced area. The area within the protective barriers will then remain a construction exclusion zone throughout the duration of the construction phase of the proposed development.
- 7.12 Wide or tall loads etc should not come into contact with retained trees. Banksman should supervise transit of vehicles where they are near retained trees.
- 7.13 Oil, bitumen, cement or other material that is potentially injurious to trees should not be stacked or discharged within 10m of a tree stem. No concrete should be mixed within 10m of a tree. Allowance should be made for the slope of ground to prevent materials running towards the tree.
- 7.14 Notice boards, telephone cables or other services should not be attached to any part of a retained tree.
- 7.15 Any trees which need to be felled adjacent to or are present within a continuous canopy of retained trees, must be removed with due care (it may be necessary to remove such trees in sections).

8.0 TREE MANAGEMENT

- 8.1 The layout of the development is currently reserved for subsequent approval. During a reserved matters application pursuant to layout, a review of the relationship between the layout and the retained trees should be undertaken by a qualified arboriculturist to assess the existing tree cover and prepare a schedule of tree works.
- 8.2 All retained trees should be subjected to sound arboricultural management as recommended within section 8.8.3 of BS5837 Post Development Management of Existing Trees, where there is a potential for public access to satisfy the landowner's duty of care.
- 8.3 Landowners responsible for trees, especially those within the public domain, have a legal 'duty of care' to ensure that visitors and neighbours of their land are reasonably safe and that nobody comes to harm or injury, by his or her negligence, through taking measures to reduce risks as far as is 'reasonably practical' (The Health and Safety at Work Act 1974).
- 8.4 To ensure that risks are reduced as far as is 'reasonably practicable' it will be necessary that, a review of the relationship between retained trees and the new development should be undertaken by a qualified arboriculturist to assess the retained tree cover and prepare a schedule of tree works.
- 8.5 The Occupiers Liability Act (1957 and 1984) also places a 'duty of care' to ensure that no reasonably foreseeable harm takes place due to tree defects. That duty of care should be reasonable, proportionate, and reasonably practicable when managing the risk⁶.
- 8.6 It is currently expected that a suitably qualified Arboriculturist or tree surveyor should inspect trees with an appropriate level of regularity. The purpose of the inspections is to determine whether a tree could foreseeably cause harm by virtue of its size and physical condition.
- 8.7 All tree works undertaken should comply with British Standard 3998:2010 and should therefore be carried out by skilled tree surgeons. It would be recommended that quotations for such work be obtained from Arboricultural Association Approved Contractors as this is the recognised authority for certification of tree work contractors.
- 8.8 All vegetation and, particularly, woody vegetation proposed for clearance should be removed outside of the bird-breeding season (March - September inclusive) as all birds are protected under the Wildlife and Countryside Act, 1981 (as amended) whilst on the nest. Where this is not possible, vegetation should be checked for the presence of nesting birds prior to removal by an experienced ecologist.

⁶ The Health and Safety at Work Act 1974

Ordnance Survey Mastermap - Crown Copyright. All rights reserved. Licence Number: 100019980 (Centremapslive.com).



 Category B - Trees / Groups of Moderate Quality (BS5837:2012)


 Category C - Trees / Groups of Low Quality
(BS5837:2012)

 Hedgerow
Colour Indicates BS5837:2012 Category

○ Root Protection Area


TI(A) GI(A)	Individual/Group number and BS5837:2012 Category
----------------	---

 Indicative Shade Pattern (in accordance with BS5837:2012 where appropriate)

AW / HR
AW / HR
drwn/chkd

scale
000 @ A1

us rev
- A

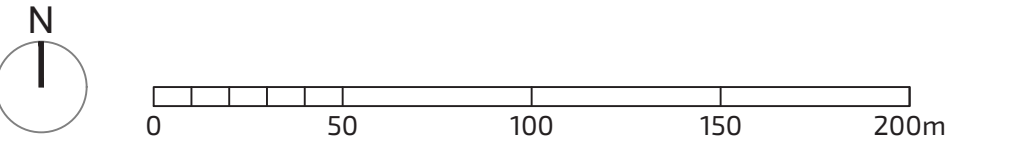

Notes:

All dimensions to be verified on site. Do not scale this drawing, use figure dimensions only. Drawing to be read in conjunction with Arboricultural Assessment and Appendix A - Tree Schedule.

The exact position of individual trees or species included as part of a tree group, woodland or hedgerow should be checked and verified site prior to and decisions for foundation design, tree operations or construction activity being undertaken. Further survey work would be required for calculation foundation depths.

- Tree/Group to be Retained
- Tree/Group proposed to be removed subject to relevant permissions
- Hedgerow Proposed to be Retained and Incorporated into the New Development
- Hedgerow proposed to be removed subject to relevant permissions
- Root Protection Area (Shown for retained trees only)
- Individual / Group Number and BS Category
- Individual / Group Number to be Removed and BS 5837:2012 Category
- Indicative Shade Pattern (in accordance with BS5837:2012 where appropriate)

-	02/10/23	First Issue	AW / HR
A	25.02.25	Layout Update	TEP / AW
B	24.04.25	Layout Update	TEP / AW
rev	date	description	drwn/chkd

client
Bloor Homes


project
Toton West

title	scale	
Tree Retention Plan	1:2000 @ A1	
number	status	rev
10889-T-02	-	B



This drawing is the property of FPCR Environment and Design Ltd and is issued on the condition it is not reproduced, retained or disclosed to any unauthorised person, either wholly or in part without written consent of FPCR Environment and Design Ltd.

Ordnance Survey Mastermap - Crown Copyright. All rights reserved. Licence Number: 100019980 (Centremapslive.com).

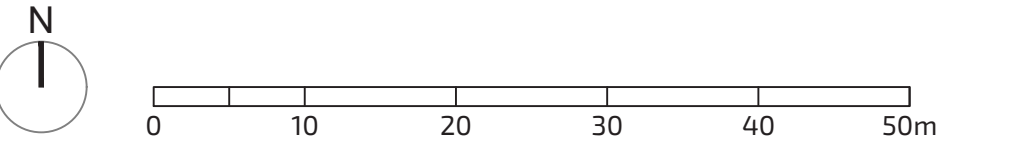

Notes:

All dimensions to be verified on site. Do not scale this drawing, use figure dimensions only. Drawing to be read in conjunction with Arboricultural Assessment and Appendix A - Tree Schedule.
The exact position of individual trees or species included as part of a tree group, woodland or hedgerow should be checked and verified site prior to and decisions for foundation design, tree operations or construction activity being undertaken. Further survey work would be required for calculation foundation depths.

- Tree/Group to be Retained
- Tree/Group proposed to be removed subject to relevant permissions
- Hedgerow Proposed to be Retained and Incorporated into the New Development
- Hedgerow proposed to be removed subject to relevant permissions
- Root Protection Area (Shown for retained trees only)
- Individual / Group Number and BS Category
- Individual / Group Number to be Removed and BS 5837:2012 Category
- Indicative Shade Pattern (in accordance with BS5837:2012 where appropriate)

-	02/10/23	First Issue	AW / HR
A	25.02.25	Layout Update	TEP / AW
B	24.04.25	Layout Update	TEP / AW
rev	date	description	drwn/chkd

client
Bloor Homes

project
Toton West

title	scale	
Tree Retention Plan	1:500 @ A1	
number	status	rev
10889-T-03	-	A

FPCR | environment & design

Appendix A - Tree Schedule

Measurements	Age Classes	Quality Assessment of BS Category	ULE (relates to BS Category)
Height - Measured using a digital laser clinometer (m)	YNG: Establishing, typically with good vigour and fast growth rates and strong apical dominance; c. less than 1/3 life expectancy	Category U - Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.	<10 years
Stem Dia. - Diameter measured (mm) in accordance with Annex C of the BS5837	SM: Semi-mature trees less than 1/3 life expectancy	Category A - Trees of high quality with an estimated remaining life expectancy of at least 40 years.	40+ years
Crown Radius - Measured using a digital laser clinometer radially from the main stem (m)	EM: Established, typically vigorous and increasing in apical height and lateral spread; 1/3 - 2/3 life expectancy. Offers landscape significance	Category B - Trees of moderate quality with an estimated remaining life expectancy of at least 20 years.	20-40 years
Abbreviations est - Estimated stem diameter avg - Average stem diameter for multiple stems upto - Maximum stem diameter of a group	M: Fully established over 2/3 life expectancy, generally good vigour and achieving full height potential with crown still spreading	Category C - Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm.	10-20 years
	OM: Fully mature, at the extremes of expected life expectancy, vigour decreasing, declining or moribund	Sub-categories: (i) - Mainly arboricultural value (ii) - Mainly landscape value (iii) - Mainly cultural or conservation value	
	V: biological, cultural or aesthetic value comprising niche saproxylic habitat. Individuals of large proportions (stem girth) in comparison to trees of the same species/surviving beyond the typical age range for their species.	The BS category particular consideration has been given to the following: • The presence of any structural defects in each tree/group and its future life expectancy • The size and form of each tree/group and its suitability within the context of a proposed development • The location of each tree relative to existing site features e.g. its screening value or landscape features • Age class and life expectancy	

Structural Condition	Physiological Condition
Good - No significant structural defects	Good - No significant health problems
Fair - Structural defects that can be remediated	Fair - Symptoms of ill-health that can be remediated
Poor - Significant defects beyond remediation, present a risk of failure in the foreseeable future	Poor - Significant ill-health. Unlikely the tree will recover in the long term
Dead - Dead tree with structural integrity of tree severely compromised	Advanced Decline / Dead - Advanced state of decline and unlikely to recover or Dead



Root Protection Area (RPA)
• The RPA Radius column provides the extent of an equivalent circle from the centre of the stem (m). • The RPA is calculated using the formulae described in paragraph 4.6.1 of British Standard 5837: 2012 and is indicative of the rooting area required for a tree to be successfully retained. Tree roots extend beyond the calculated RPA in many cases and where possible a greater distance should be protected. • Where veteran trees have been identified the RPA has been calculated in accordance with Natural England guidance i.e. 15x the stem diameter, uncapped.

Appendix Summary

	Individual Trees	Totals	Tree Groups and Hedgerows	Totals
Category U		0		0
Category A		0		0
Category B		0	G4, G7, G8, G9, G11, G12, G17	7
Category C	T1	1	G1, G2, G3, G5, G6, G10, G13, G14, G15, G16, G18, H1, H2, H3, H4, H5, H6	17
	Total	1	Total	24

BS Category Tree Type Distribution displays the proportion of trees assessed in each type to enable a better understanding of the category distribution.

BS Category Site Wide Distribution shows the proportion of trees assessed in each category across the whole site which allows an interpretation of the site's overall quality.

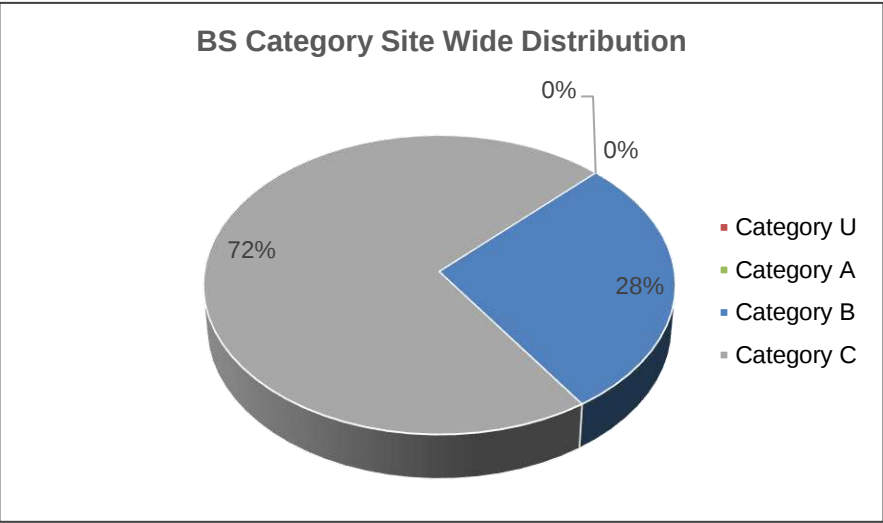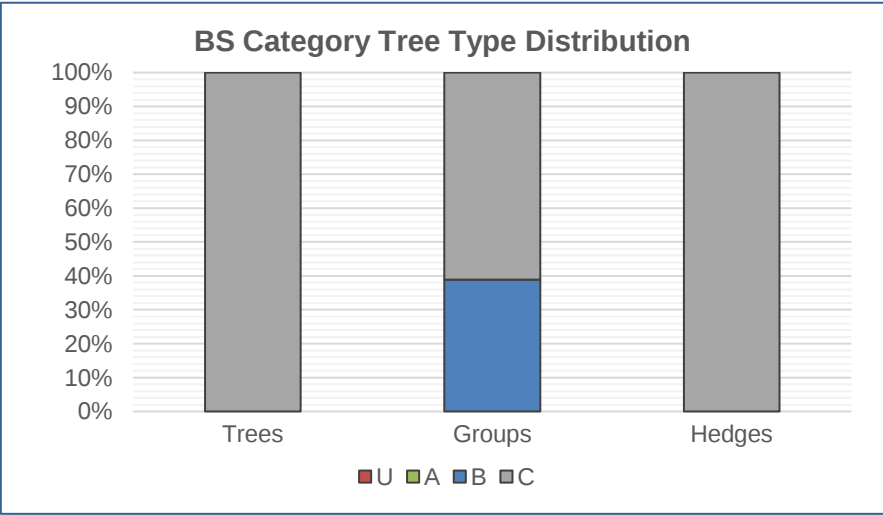

Tree No	Species	Height	Stem Dia.	Crown Radius	Age Class	Overall Condition	Structural Condition	RPA	RPA Radius	BS5837 Cat
INDIVIDUAL TREES										
T1	Ash Fraxinus excelsior	16	est 800	6	M	F	Established basal growth Dieback of crown Large brown branches	290	9.6	C (i)
T2	Tree No Longer Present									

Group No	Species	Height	Stem Dia.	Crown Radius	Age Class	Overall Condition	Structural Condition	RPA	RPA Radius	BS5837 Cat
GROUPS OF TREES										
G1	Ash Fraxinus excelsior Blackthorn Prunus spinosa Elder Sambucus nigra Hawthorn Crataegus monogyna Silver Birch Betula pendula Sycamore Acer pseudoplatanus Wild Cherry Prunus avium Apple Malus domestica Crab Apple Malus sylvestris Hazel Corylus avellana Holly Ilex aquifolium Laburnum Laburnum anagyroides Laural Prunus Laurocerasus Norway Maple Crimson King Acer platanoides 'Crimson King' Purple Plum Prunus cerasifera Pissardii Rowan Sorbus aucuparia Lawson Cypress Chamaecyparis lawsoniana Scots Pine Pinus sylvestris Contorted Willow Salix matsudana Tortuosa Common Juniper Juniperus communis	5	avg 130	2	SM / EM / M	F	Broken branches evident Characteristic for species No major defects were noted Boundary group that runs along rear gardens of abutting properties Ownership unknown Some sections managed as hedgerows but majority is unmaintained	8	1.6	C (ii)


Group No	Species	Height	Stem Dia.	Crown Radius	Age Class	Overall Condition	Structural Condition	RPA	RPA Radius	BS5837 Cat
G2	Ash Fraxinus excelsior Elder Sambucus nigra English Oak Quercus robur Hawthorn Crataegus monogyna	6	avg 210	3	EM	F	Offsite group of self set trees Dense undergrowth HV lines above No major defects	20	2.5	C (ii)
G3	Ash Fraxinus excelsior Hawthorn Crataegus monogyna Hybrid Black Poplar Populus x canadensis	10	est 400	6	EM / M	F	Bark wounds noted Base obscured Branch stubs evident Broken branches evident Characteristic for species Close cultivation of the soil Dieback of the crown observed Minor dead wood evident in the crown (<75mm)	72	4.8	C (ii)
G4	Hybrid Black Poplar Populus x canadensis	12	avg 400	6	M	F	Base obscured Branch socket cavities observed Close cultivation of the soil Epicormic growth evident within the crown Seven trees Deadwood throughout	72	4.8	B (ii)
G5	Ash Fraxinus excelsior Blackthorn Prunus spinosa Elder Sambucus nigra Field Maple Acer campestre Hawthorn Crataegus monogyna Silver Birch Betula pendula	8	avg 200	4	SM / EM / M	F	Offsite trees which screens views towards Toton sidings Limited in arboricultural value but offers moderate landscaping value by restricting views if the railway lines Typical features such as broken branches and deadwood observed	18	2.4	C (ii)
G6	Elder Sambucus nigra Hawthorn Crataegus monogyna	4	avg 140	3	M	F	Sporadic self set trees of Limited arboricultural and landscape value Situated offsite	9	1.7	C (ii)

Group No	Species	Height	Stem Dia.	Crown Radius	Age Class	Overall Condition	Structural Condition	RPA	RPA Radius	BS5837 Cat
G7	Ash Fraxinus excelsior Common Lime Tilia x europaea Elder Sambucus nigra Hybrid Black Poplar Populus x canadensis Silver Birch Betula pendula Sycamore Acer pseudoplatanus Lombardy Poplar Populus nigra 'Italica'	18	avg 500	6	M	F	Dense undergrowth at the base Dieback of the crown observed Epicormic growth evident within the crown Minor dead wood evident in the crown (<75mm) Twin stemmed from base Typical crown form Unable to gain access due to location around active building site Moderate landscape value tree group is visible from across the site Arboriculturally some trees are in a poor condition with extensive dieback and major deadwood being noted	113	6.0	B (ii)
G8	Ash Fraxinus excelsior Beech Fagus sylvatica Elder Sambucus nigra Hawthorn Crataegus monogyna	19	avg 550	6	EM / M	F	Established boundary group which screens the substation to the east Unable to gain access due to offsite location No obvious major defects where noted	137	6.6	B (ii)
G9	Common Lime Tilia x europaea	10	avg 460	3	M	F	Bark wounds noted Basal suckers present Characteristic for species Compacted ground at the base Typical crown form Highway trees located within footpath Recently re Pollarded with new growth observed Mechanic damage noted at the base of a number of specimens	96	5.5	B (ii)
G10	Ash Fraxinus excelsior Elder Sambucus nigra English Oak Quercus robur Hawthorn Crataegus monogyna Silver Birch Betula pendula	8	est 300	4	EM	P / F	Crossing and rubbing branches Dense undergrowth at the base Etiolated form Interlocking crowns Self set group of trees which are competing with each other due to density	41	3.6	C (ii)
G11	Common Lime Tilia x europaea English Oak Quercus robur	18	est 600	6	Yng / M	F	Linear row of mature lime trees which display Typical characteristics and no major defects Young self set oak sporadically growing amongst group Unable to gain access to stems due to low crown form and extensive established basal growth	163	7.2	B (ii)

Group No	Species	Height	Stem Dia.	Crown Radius	Age Class	Overall Condition	Structural Condition	RPA	RPA Radius	BS5837 Cat
G12	Ash Fraxinus excelsior Common Lime Tilia x europaea Elder Sambucus nigra English Oak Quercus robur Hawthorn Crataegus monogyna Horse Chestnut Aesculus hippocastanum Copper Beech Fagus sylvatica purpurea Lombardy Poplar Populus nigra 'Italica' Lawson Cypress Chamaecyparis lawsoniana	20	avg 700	9	EM / M	F	Branch socket cavities observed Branch stubs evident Broken branches evident Characteristic for species Close cultivation of the soil Linear group of trees running along boundary Smaller understory growth situated on site with larger more established trees found within the rear gardens of the abutting properties Forms a buffer between the site and the dwellings Torn out limbs and Pruning wounds noted in garden specimens	222	8.4	B (ii)
G13	Ash Fraxinus excelsior	8	avg 210	3	EM	F	Situated in the middle of field parcel Limited future potential	20	2.5	C (ii)
G14	Ash Fraxinus excelsior Lawson Cypress Chamaecyparis lawsoniana	8	avg 210	3	EM	F	Dense undergrowth Limited value	20	2.5	C (ii)
G15	Ash Fraxinus excelsior Hawthorn Crataegus monogyna Sycamore Acer pseudoplatanus Wild Cherry Prunus avium Crab Apple Malus sylvestris Damson Prunus insititia Laural Prunus Laurocerasus Purple Plum Prunus cerasifera Pissardii Butterfly bush Buddleia davidii	13	avg 300	4	EM / M	F	Group of trees which screens the electricity substation to the north Dense undergrowth and ivy throughout Hardstanding noted to the north and Compacted farm track to the south Ash specimens are showing signs of dieback	41	3.6	C (ii)


Group No	Species	Height	Stem Dia.	Crown Radius	Age Class	Overall Condition	Structural Condition	RPA	RPA Radius	BS5837 Cat
G16	Leyland Cypress Cupressocyparis leylandii	17	est 400	3	M	F	Linear planted group Limited arboricultural value Maintained by lateral flail Compaction at base	72	4.8	C (ii)
G17	Ash Fraxinus excelsior Beech Fagus sylvatica Hawthorn Crataegus monogyna Wild Cherry Prunus avium Yew Taxus baccata	12	avg 480	5	EM / M	F	Base obscured Branch stubs evident Broken branches evident Characteristic for species Crossing and rubbing branches Dense ivy cover on main stem Dense undergrowth at the base Epicormic growth evident within the crown Ownership undetermined Screens substation	104	5.8	B (ii)
G18	Ash Fraxinus excelsior Silver Birch Betula pendula Magnolia Magnolia grandiflora Stag's Horn Sumach Rhus typhina	8	est 210	3	EM / M	F	Offsite garden group Unable to gain access Typical form and features	20	2.5	C (ii)

Hedge No	Species	Height	Stem Dia.	Crown Radius	Age Class	Overall Condition	Structural Condition	RPA	RPA Radius	BS5837 Cat
HEDGEROWS										
H1	Elder Sambucus nigra Hawthorn Crataegus monogyna	2	avg 6x 60	0.5	M	F	Maintained hedgerow	10	1.8	C (ii)
H2	Elder Sambucus nigra Hawthorn Crataegus monogyna	2	avg 6x 60	0.5	M	F	Maintained hedgerow	10	1.8	C (ii)
H3	Elder Sambucus nigra Hawthorn Crataegus monogyna	2	avg 6x 60	0.5	M	F	Maintained hedgerow Occasional gaps	10	1.8	C (ii)
H4	Blackthorn Prunus spinosa Elder Sambucus nigra Hawthorn Crataegus monogyna	2	avg 6x 60	0.5	M	F	Maintained hedgerow	10	1.8	C (ii)
H5	Elder Sambucus nigra Hawthorn Crataegus monogyna	1	avg 6x 60	0.5	M	F	Maintained hedgerow	10	1.8	C (ii)
H6	Lawson Cypress Chamaecyparis lawsoniana	2.5	avg 100	0.5	M	F	Maintained boundary hedgerow	5	1.2	C (ii)

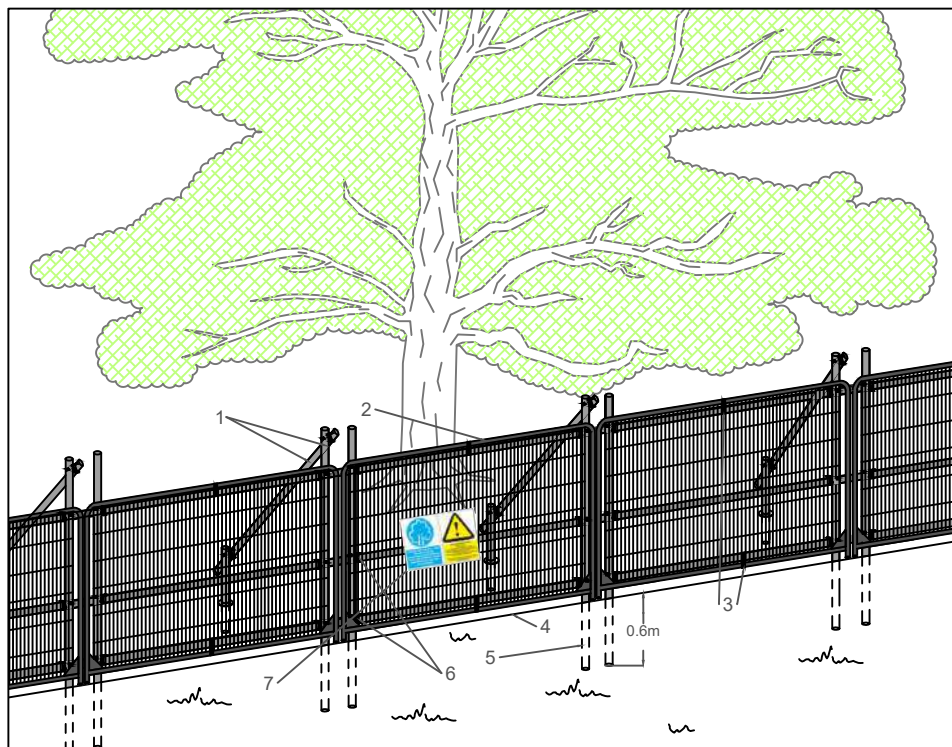

Specification for High Intensity Protection Barrier

1. Standard scaffold poles
2. Heavy gauge 2m tall galvanized tube and welded mesh infill panels
3. Panels secured to scaffold frame with wire ties
4. Ground level
5. Uprights driven into the ground until secure (min depth of 0.6m)
6. Standard scaffold clamps
7. Construction Exclusion Zone signs

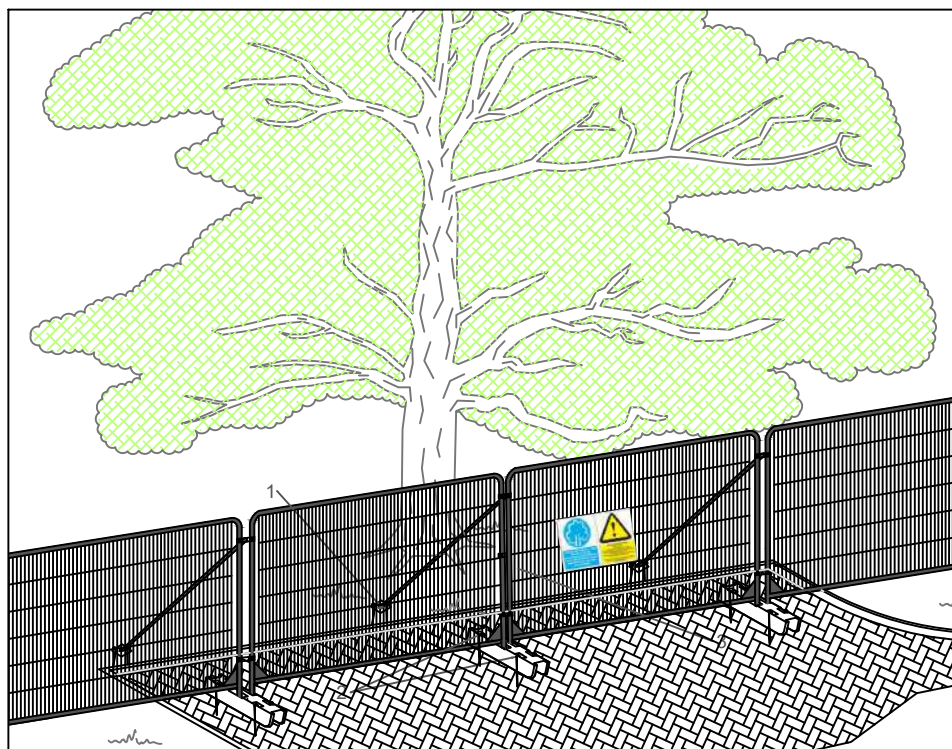

Specification for Low Intensity Protection Barrier

1. Stabiliser strut with base plate secured with ground pins
2. Feet blocks secured with ground pins
3. Construction Exclusion Zone signs

APPENDIX B PROTECTIVE FENCING SPECIFICATIONS

This drawing is the property of FPCR Environment and Design Ltd and is issued on the condition it is not reproduced, retained or disclosed to any unauthorised person, either wholly or in part without written consent of FPCR Environment and Design Ltd.

Ordnance Survey Mastermap - Crown Copyright. All rights reserved.
Licence Number: 100019980 (Centremapslive.com).

FPCR | environment
& design

FPCR Environment and Design Ltd

Registered Office: Lockington Hall, Lockington, Derby DE74 2RH
Company No. 07128076. [T] 01509 672772 [E] mail@fpcr.co.uk [W] www.fpcr.co.uk

This report is the property of FPCR Environment and Design Ltd and is issued on the condition it is not reproduced, retained or disclosed to any unauthorised person, either wholly or in part without the written consent of FPCR Environment and Design Ltd. Ordnance Survey material is used with permission of The Controller of HMSO, Crown copyright 100019980.